

Date: Tuesday, 12/5/2006 8:09:18 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350/355 AS X-TUBE AFT
 Job Number : 29761
 Estimate Number : 12486
 P.O. Number : *N/A* Part Number : D350748201
 This Issue : 12/5/2006 S.O. No. : *N/A* Drawing Number : IIN-D350-748 PG5
 Prsht Rev. : NC Project Number : N/A
 First Issue : *N/A* Type : LANDING GEAR Drawing Revision : A ~~UNDER REVIEW~~ *OK 06.11.05*
 Previous Run : 28777 Material : *N/A*
 Due Date : 1/30/2007 Qty: 1 Um: Each
 Written By : *[Signature]*
 Checked & Approved By : *[Signature] 06 12 05*
 Comment : Est Rev: A New Issue 06-07-05 JLM
 Est Rev: B Update qty of MS21042L5 06-09-12 KJ

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: Photocopy bluefile & type labels per PPPD350-748-201		CHG001
---	--	--------

KS 07.01.18

2.0	29761A	X-TUBE AS 350/355 HI AFT
-----	--------	--------------------------



Comment: Sub-Component X-TUBE AS 350/355 HI AFT D350-748-241 B		
---	--	--

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1 Pick Packing Kit		
--	--	--

4.0	D35001	350 SADDLE
-----	--------	------------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s) 350 SADDLE Batch: <i>D28794</i>		
---	--	--

*CP**✓*

5.0	D35011	BUSHING
-----	--------	---------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s) BUSHING Batch: <i>B28478</i>		
--	--	--

*CP**PS 7/07/240*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:18 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 29761

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

AN46A

Bolt



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Bolt

Batch: M103962 ✓

EP ✓

7.0

AN441A

bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

bolt

Batch: M102552 ✓

EP ✓

8.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M103481 ✓

EP ✓

9.0

AN960JD416

Washer



Comment: Qty.: 32.0000 Each(s)/Unit Total : 32.0000 Each(s)

Washer

Batch: M104215 ✓

EP ✓

10.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: M104156 ✓

EP ✓

11.0

MS21042L4

Nut



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Nut

Batch: M102552 ✓

EP ✓

12.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M103830 ✓

EP ✓

EP 57/07/240

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 03/02/04
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:18 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 29761

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-201

Location: _____

PPP Rev: A

15.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 07-07-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

3.10 Apply a continuous bead of Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class B2 sealant in the following locations as per Figure 6:

- A) Along saddle/crosstube interface.
- B) Between the saddle flanges.
- C) Along saddle/skidtube interface.

4.0 WEIGHT AND BALANCE

The following weight and balance information is for Dart crosstube installations only. This data should be similar to the existing installation. Differences from the parts removed are the responsibility of the installer.

DART CROSSTUBE	FWD/AFT	WEIGHT	STA	MOMENT
D350-748-101	Fwd	35.2 lb (16.0 kg)	106.3 in (2.70 m)	3742 lb-in (43.2 kg-m)
D350-748-201	Aft	34.7 lb (15.7 kg)	162.4 in (4.12 m)	5635 lb-in (64.7 kg-m)

5.0 PARTS LIST

Qty -101	Qty -201	Part Number	Description
X		D350-748-101	CROSSTUBE INSTALLATION, AS 350/355 HIGH FWD
	X	D350-748-201	CROSSTUBE INSTALLATION, AS 350/355 HIGH AFT
1		D350-748-141	CROSSTUBE ASSEMBLY, AS 350/355 HIGH FWD
	1	D350-748-241	CROSSTUBE ASSEMBLY, AS 350/355 HIGH AFT
*2	*2	D3502-1	SUPPORT
*2	*2	D2856-400-710	ABRASION STRIP
*1	*1	AELS-1032-225	INSERT
*2	*2	MS21920-20	CLAMP
*1	*1	MS27039-1-10	SCREW
*1	*1	AN960JD10	WASHER
4	4	D3500-1	SADDLE
16	16	D3501-1	BUSHING
16	16	AN4-6A	BOLT
8	8	AN4-41A	BOLT
4	4	AN5-32A	BOLT
32	32	AN960JD416	WASHER
8	8	AN960JD516	WASHER
24	24	MS21042L4	NUT (OR MS21042-4)
4	4	MS21042L5	NUT (OR MS21042-5)

* REFERENCE ONLY. PARTS ARE INCLUDED IN D350-748-141/241 ASSEMBLIES ABOVE

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29761

Date: Tuesday, 12/5/2006 8:09:42 AM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: X-TUBE AS 350/355 HI AFT
Job Number	: 29761A		
Estimate Number	: 12483		
P.O. Number	: N/A	Part Number	: D350748241
This Issue	: 12/5/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D350-748-241
First Issue	: N/A	Project Number	: N/A
Previous Run	: 28777A	Drawing Revision	: UNDER REVIEW D
		Material	: N/A
Written By	:	Due Date	: 1/30/2007
Checked & Approved By	: <u>061205</u>	Qty:	1 Um: Each
Comment	: Est Rev: A New Issue 06-07-05 JLM : Est Rev: B Update cadplate process 06-09-12 KJ		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D350-748-241 CHG001

plk

2.0	D6018125	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Crosstube Material

D6018-125

2.299" OD X 2.000" ID

Batch: 27472

BG 06-12-08

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA647

2-Turn first side as per Folio FA647

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

BG 06-12-08 1

4.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

BG 06-12-08 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:42 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 29761A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA647

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

3-Scribe part # as per Dwg D350-748-241

BG 06.12.05

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

BG 06.17.08

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

J.G 06/12/08

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Remove all Machining Marks

Pm/JK 06/12/13

①

9.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: 2725

Heat Treat to min 180 KSI As per Dwg D350-748-241

Sand Blast tube after Heat Treat

Possible Supplier: Vac Aero

Ensure Certificate of Conformity is attached

CL 06/12/15

①

10.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformity is attached

CL 7/6/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:42 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 29761A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

07/01/29

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Oil inside of tube with LPS-3.

A/R

LPS-3

Batch:

M103581

DP 7-3-15

13.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT

DP 7-3-15

14.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

07/03/21 @

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Remove all marks from tube within limits of D350-748-241

2-Drill Tube as per Dwg D350-748-241 Using DT8876 Drill Jigs,

Set-up drill table as per QSI 010

3-Deburr

4-Engrave Part # and Batch # as per Dwg D350-748-241

JD 7-4-16

DP 7-6-13

16.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

04-06-13 @

17.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: 3975

Stress relief at 375° for 5 hours

Magnetic Particle Inspect per ASTM E1444

Cadium Plate per QQ-P-416F, Class 1, Type 2

07/06/14 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:43 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 29761A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Embrittle relief at 375° for 8 hours, Chromate Treat
Possible Supplier: Southwest United Industries
Ensure Certificate of Conformity is attached

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage
Ensure certificate of conformity is attached

EP 07/07/09 @
207-10

19.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside crosstube as per QSI 005 4.2

2-Paint Outside of Tube as per Dart QSI 005 4.2

ml 07 07 18 *(1)*

21.0

QC14

Inspect Spray Paint



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

BT 07-07-19

22.0

D35021

SUPPORT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

SUPPORT

Batch: *28476*

ml 07 07 23

23.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2401 f(s)/Unit Total: 1.2401 f(s)

Abrasion Strip 7.10" long x2

Batch: *32020*

ml 07 07 23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:43 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 29761A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

ALS41032225

Insert



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Insert

Batch: 19393

01 01 23

25.0

AN960JD10

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Washer

Batch: 100151

ml 01 01 23

26.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Clamp (per MIL-DTL-8783C)

Batch: 104902

ml 01 01 23

27.0

MS27039110

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Screw

Batch: 18836

ml 01 01 23

28.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install Ground wire Insert, then insert screw and washer

2-Install Abrasion strips as per Dwg D350-748-241 & QSI 035.

3-Install supports Using Dt8876 as per Dwg D350-748-241, Torque to 60-80 IN-LBS

ml 01 01 23

29.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/07/04 (R)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: Q Date: 5/17/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/5/2006 8:09:43 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 29761A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-241

Location:

PPP Rev:

B

29761

EP 07/07/240
07/17/04(U)

31.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/07/240

Job Completion



07/07/240

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Crosstube Bend Dimension Sheet

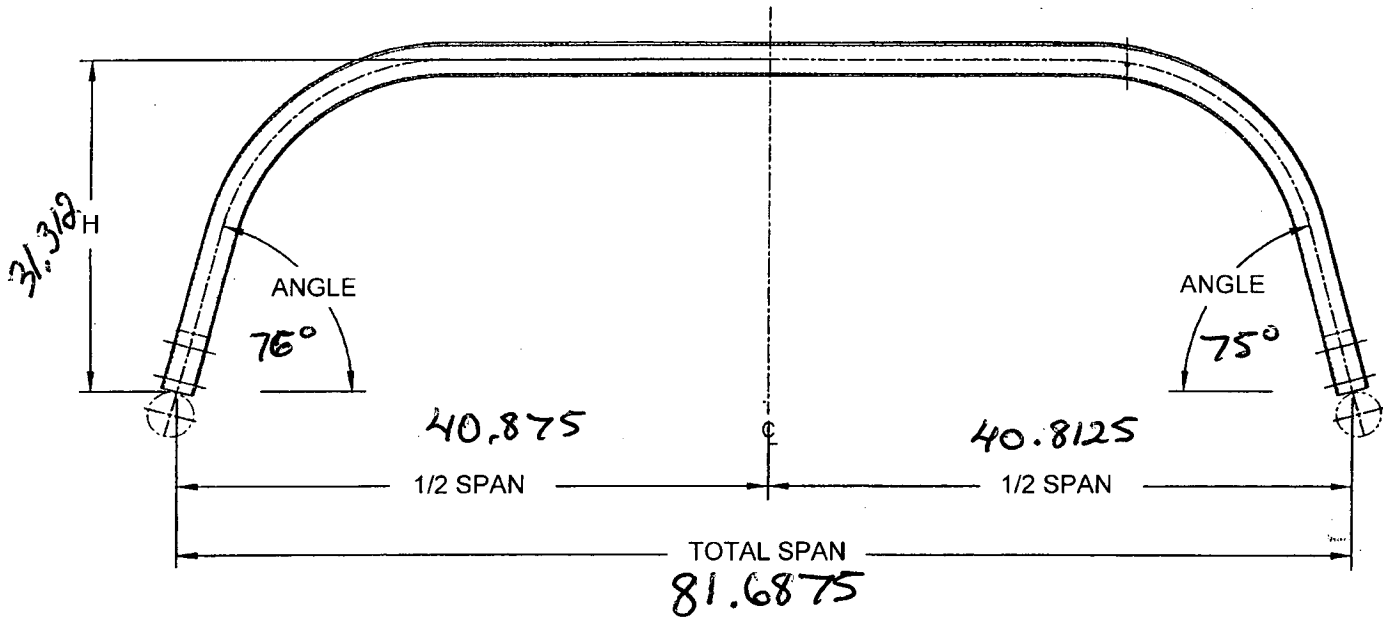

PART NUMBER: 350 748 241

BATCH NUMBER: 29761A

DRAWING 350 748 241 REVISION: A

H: 31.35

$1/2$ SPAN: 40.9

TOTAL SPAN: 81.8

ANGLE: 75°

QC 15: A

DATE: 07/09/21

QTY: (1)

DART**RELEASED**

06.10.31

DESIGN QP	DRAWN BY QP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED H	APPROVED H	DRAWING NO. D350-748-241	REV. D SHEET 1 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	
D	06.10.31	MAG. PARTICLE AND CAD PLATE AS MFD.	

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW


D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING
- 6) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29761A

Copyright © 2006 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

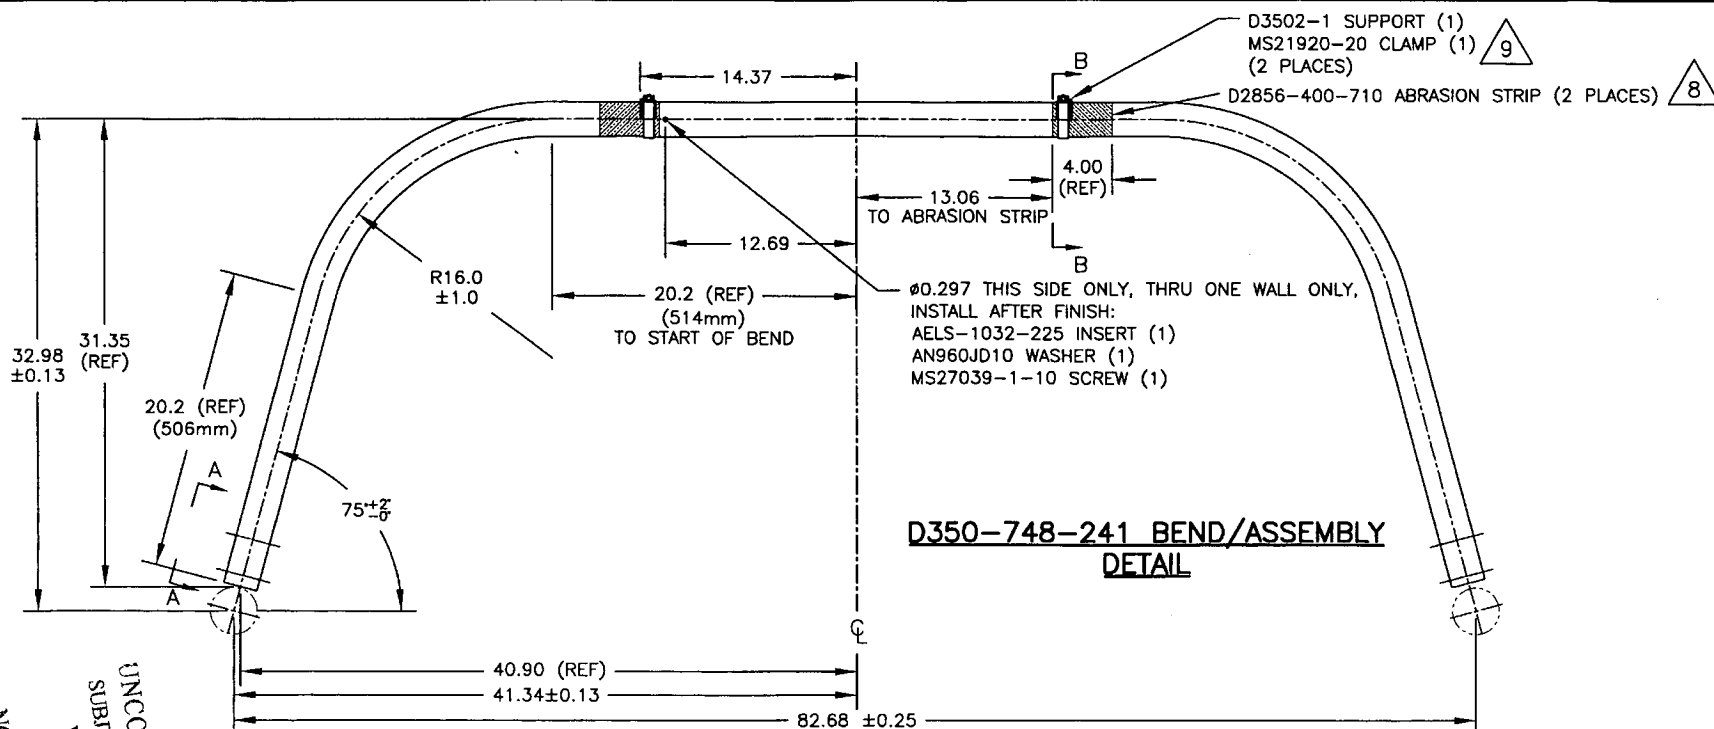

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29761A

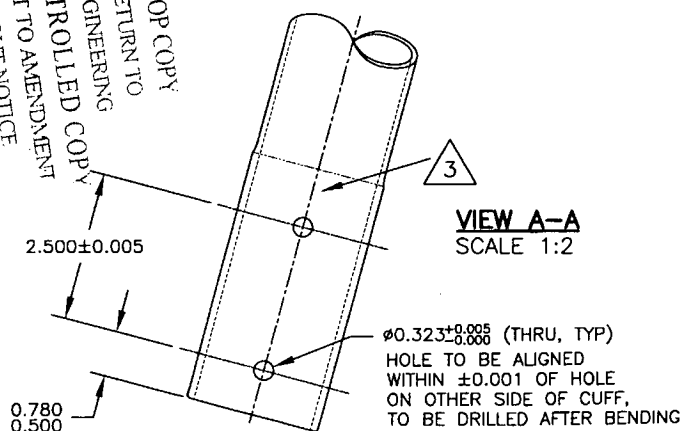

**SECTION B-B
SCALE 1:2**

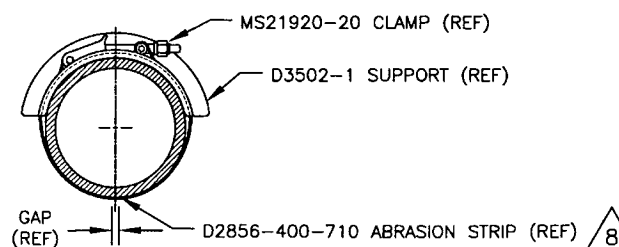

RELEASED

06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN *qp*
CHECKED *#*
DATE 06.10.31

DRAWN BY *qp*
APPROVED *#*

DART
DRAWING NO.
D350-748-241

DART AEROSPACE LTD.
HARRISBURG, ONTARIO, CANADA


REV. D

SHEET 2 OF 3

SCALE



TITLE
CROSSTUBE (AS 350/355 HI AFT)

1:8

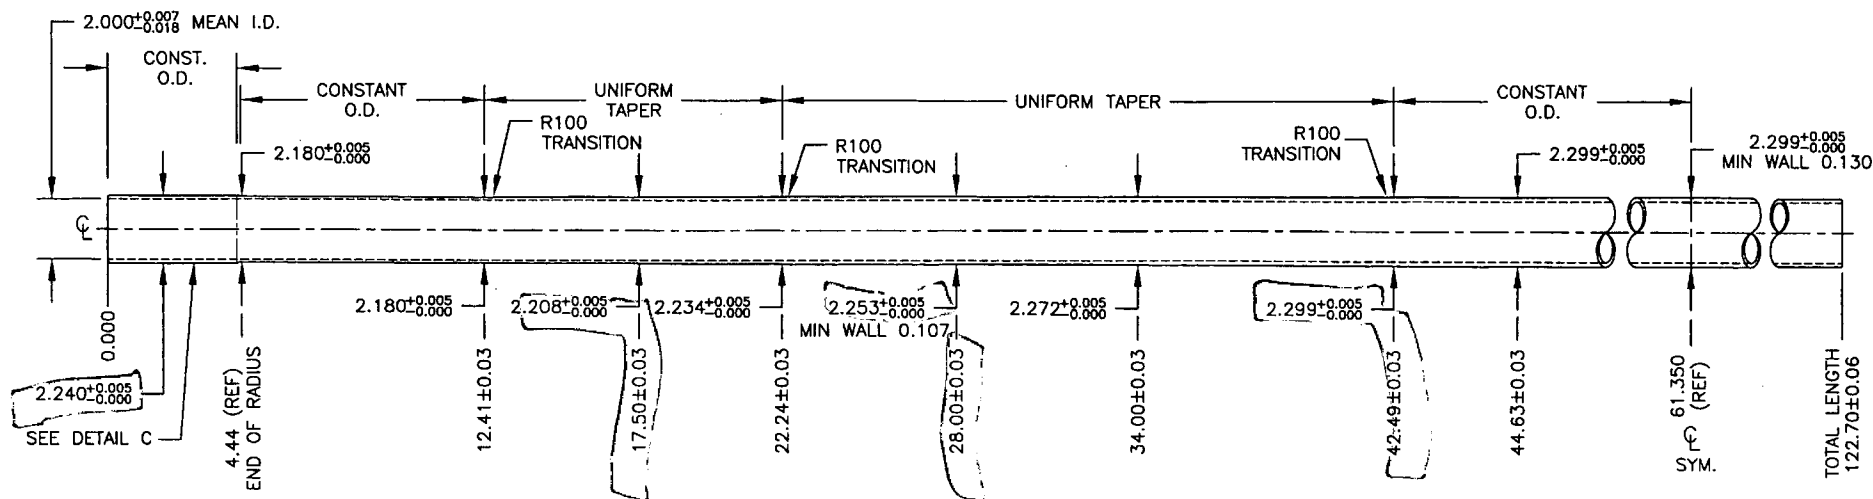

D350-748-241 MACHINING DETAIL

**DETAIL C: CUFF
SCALE 1:1**

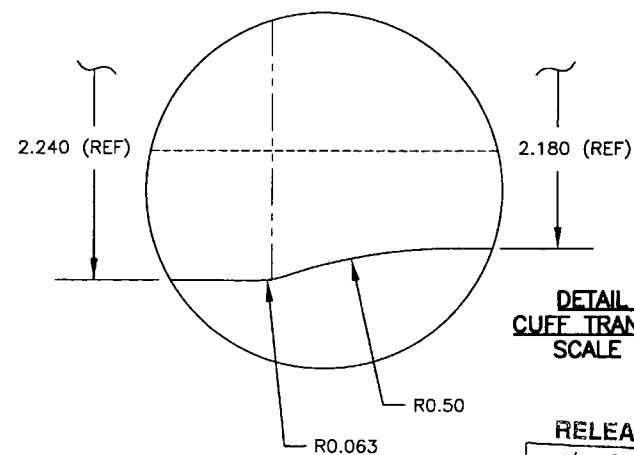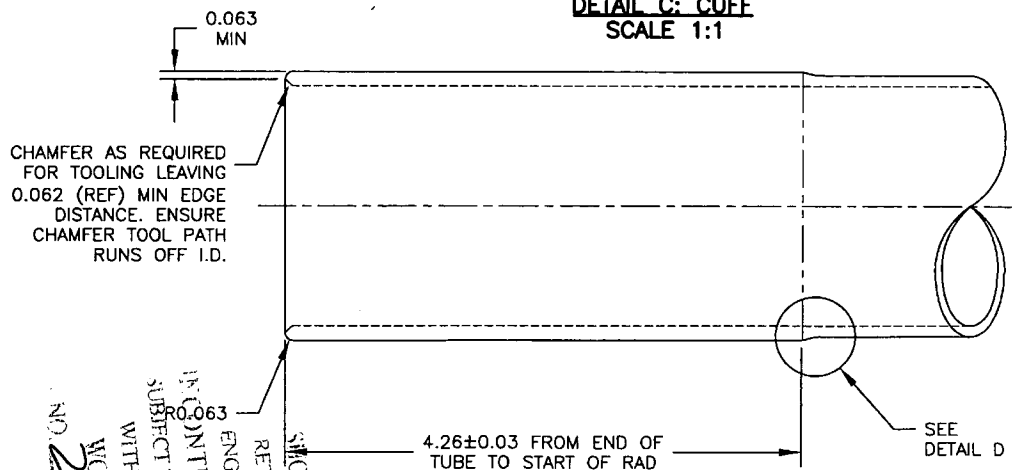

**DETAIL D:
CUFF TRANSITION
SCALE 9:1**

RELEASED

06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.		DESIGN	qf	DRAWN BY	qf	DART	DART AEROSPACE LTD. WILLOWBURT, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	#	APPROVED	#	DRAWING NO.	REV. D
		DATE	06.10.31			D350-748-241	SHEET 3 OF 3
						TITLE	SCALE
						CROSSTUBE (AS 350/355 HI AFT)	1:4

NO. 29761A
WORK ORDER
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
STOP COPY
RETURN TO

DART AEROSPACE LTD		Work Order:	
Description: Crosstube Assembly		Part Number:	D350748241
Inspection Dwg: D350-748-24 Rev: C		Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005 -0.000	2.244				
	2.180	+0.005 -0.000	2.185				
	2.208	+0.005 -0.000	2.212				
	2.234	+0.005 -0.000	2.237				
	2.253	+0.005 -0.000	2.256				
	2.272	+0.005 -0.000	2.277				
	2.299	+0.005 -0.000	2.302				
	.063	+0.010 -0.000	.063				
	R.50	+0.010 -0.000	.500				
	4.26	+0.030 -0.000	4.26				
SIDE B	2.240	+0.005 -0.000	2.244				
	2.180	+0.005 -0.000	2.185				
	2.208	+0.005 -0.000	2.212				
	2.234	+0.005 -0.000	2.238				
	2.253	+0.005 -0.000	2.256				
	2.272	+0.005 -0.000	2.277				
	2.299	+0.005 -0.000	2.301				
	.063	+0.010 -0.000	.063				
	R.50	+0.010 -0.000	.500				
	4.26	+0.030 -0.000	4.26				
	122.7	±0.06	122.7				

Measured by: SG	Audited by: J.G	Prototype Approval:	N/A
Date: 06.12.08	Date: 06/12/08	Date:	N/A
Rev	Date	Change	Revised by
A		New Issue	KJ/JLM
		Approved	

DART AEROSPACE LTD		Work Order:	
Description: CrossTube Assembly (AS350/355 High Aft)		Part Number:	D350-748-241
Inspection: Dwg: D350-748-241 Rev: C		Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A							
SIDE B							

Measured by:		Audited by:		Prototype Approval:	N/A
Date:		Date:		Date:	N/A

Rev	Date	Change	Revised by	Approved
A		New Issue (P/O D350-748-201)	KJ/JLM	



VAC AERO
INTERNATIONAL INC.

RELEASE NO

GST No. : R105468102

OAK 82647-1



HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489



2009 WYECROFT ROAD, UNIT B
OAKVILLE, ONTARIO
CANADA L6I 6J4
TEL: (905) 827-7377 FAX: (905) 827-1380



QUEBEC DIVISION
7450 RUE VÉRITÉ STREET, ST. LAURENT, QUÉBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX: (514) 334-6269

01/11/2007

MM / DD / YYYY

PAGE : 1

1DAR01
BILL TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
01/11/2007	EPIC EXPRESS	ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
PO00002725		COD

PART No.	DESCRIPTION	UOM	QTY ORD	QTY SHPD	TEST RESULTS
D350-CROSS TUBES D350-748-141	-241	EA	8	8	
<p>Process Specifications: Procedure: 4353 HEAT TREATED TO 180-200 KSI PER AMS 2759-1C 100% HARDNESS TESTED PER ASTM E-18 HRC 40-43 MATERIAL: 4130</p> <p>REF. PS# 59054 RE: B29758A, B29757A, B29760A, B29765A, B29761A, B29764A, B29763A, B29762A</p> <p>100% HARDNESS TESTED 8 pcs. 42/43 HRC</p> <p>VA.I.O. TH. 25 Q.C.</p> <p>07/01/29</p>					

I hereby certify that the material covered by this release note has been inspected and tested and conforms to all specifications relevant thereto in accordance with the conditions of the contract / or purchase order.

ON BEHALF OF VAC AERO INTERNATIONAL INC

Diana Sherman
Authorized Q.C. Inspector



VACUUM BRAZING · HEAT TREATING · SPECIAL PROCESSING · FURNACE EQUIPMENT
TURBINE COMPONENT OVERHAUL · PLASMA AND OTHER COATINGS



HEAT
TREATING

**CERTIFICATE OF
CONFORMANCE**

**CADORATH PLATING CO. LTD.
2150 LOGAN AVENUE
WINNIPEG, MANITOBA R2J-0J1**

DATE: Jun-29-2007

CONSIGNED TO: Dart Aerospace Ltd.
1270 Aberdeen St.
Hawksbury, ON K6A 1K7

W/O #: 68046
INVOICE #: 35047

**CONTRACT OR
PURCHASE ORDER #** P000003975

DESCRIPTION: SKID

QTY 1

P/N # D350748241 ✓

S/N # B29761 ✓

MPI IAW ASTM-E-1444. CADMIUM PLATE IAW AMS-QQ-P-416 TYPE 2
CLASS 2. BAKE HEAT CART #7951 AND 7997

CERTIFICATE: I certify that the items indicated here on have
been inspected and tested and conform to all specifications
and requirements detailed on the contract or purchase order.

Approved Inspector:

William Marozzani



Packing Slip



Cadorath Plating Co. Ltd.

2150 Logan Avenue, Winnipeg, Manitoba R2R-0J2

Phone: (204) 633-9420 Fax: (204) 633-8033

Sold To

Dart Aerospace Ltd.

1270 Aberdeen St.

Hawkesbury, ON K6A 1K7

Ship To:**INVOICE NUMBER:**

35047

Net 2% Interest Per Month charged on Overdue Accounts.

Any claims for shortages, overcharges, or damaged goods must be made within seven (7) days from receipt of goods.

Customer Order #:	Date Received:	Terms:	G.S.T. #:	Ship Via:	Ship Date:
P000003975	Jun-19-2007	NET 30 DAYS	10071 6547 RT0001		Jun-29-2007

Item # Qty P/N & Description

1	1 EA	SKID	S/N B31017
		P/N D350748141	W/O 68044
2	1 EA	SKID	S/N B31015
		P/N D350748141	W/O 68045
3	1 EA	SKID	S/N B29761
		P/N D350748241	W/O 68046
4	1 EA	SKID	S/N B29763
		P/N D350748241	W/O 68047
5	1 EA	SKID	S/N B28777
		P/N D350748241	W/O 68048

